





Dimensions in mm

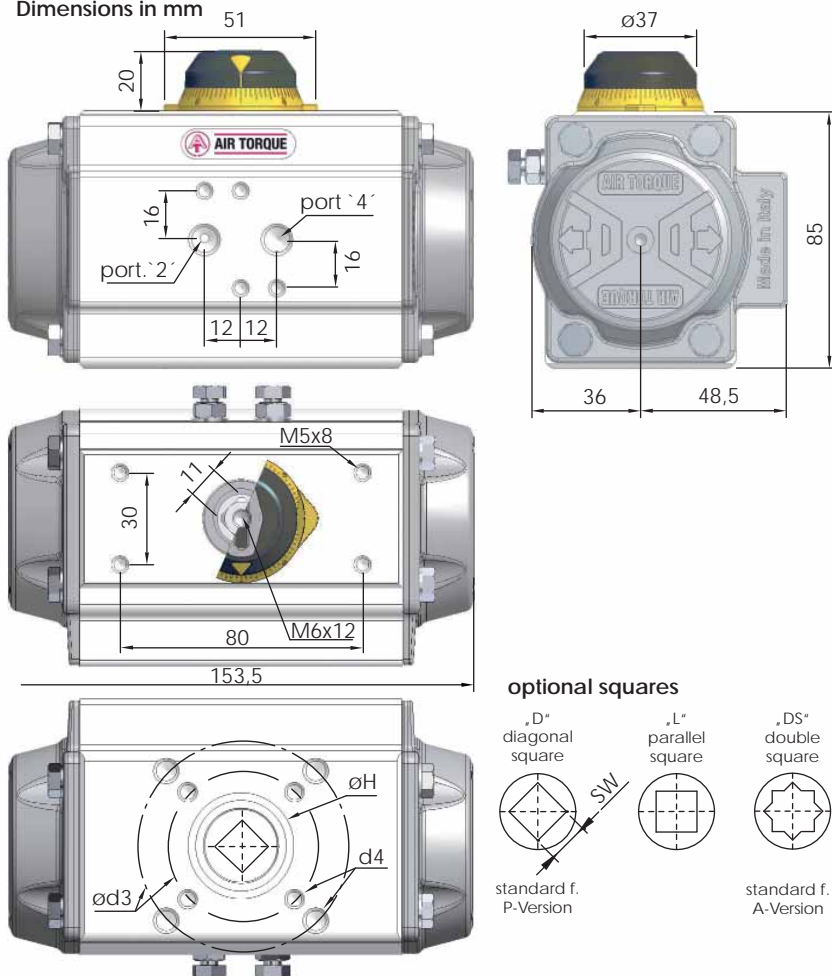

ISO 5211 - available flanges

ISO 5211	Standard		optional			
	F05 + F07	F03* + F05	F04 + F07	F05		
$\varnothing d2$	35	25	30	35		
$\varnothing d3$	50	70	42	70	50	
d4	M6x9	M8x12	M5x8	M6x9	M5x8	M8x12
$\varnothing H$	35	25	30	35		
SW x I	D		9 x 11 - 14 x 16			
min. DS	14 x 16		11 x 18 - 14 x 16			
h min.	0,5	0,5	0,5	0,5	0,5	0,5
h1	2	-	1,5	-	2	-


*before selecting the flange connection please consider the indications of standard n° 5211 on page 0911 of our manual for op. and maintenance

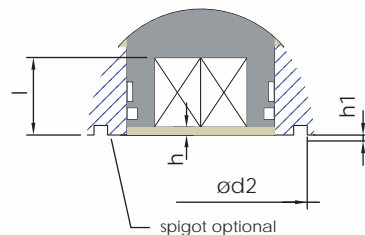


Connection / Attachment

Pressure connection Port 2 and 4	G1/8"
Ancillaries attachment	AA 1

Rotation and stroke adjustment

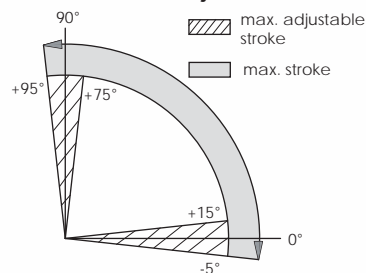

optional squares

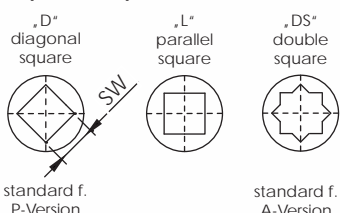

Pressure	Output torque for double acting and spring return in Nm												Spring torque		approx. weight in kg										
	2,5 bar		3 bar		3,5 bar		4 bar		4,2 bar		4,5 bar		5 bar			5,5 bar		6 bar		7 bar		8 bar		90°	0°
	0°	90°	0°	90°	0°	90°	0°	90°	0°	90°	0°	90°	0°	90°		0°	90°	0°	90°	0°	90°	0°	90°		
DR	14,7	17,6	20,5	23,5	24,6	26,4	29,3	32	35,2	41	46,9	-	-	1,61											

SC 2/3	9,1	6,2	12,0	9,2	15,0	12,1	17,9	15	19,1	16,2	20,8	17,9	23,8	20,9									8,4	5,5	1,71											
SC 3	8,0	4,5	10,9	7,5	13,9	10,4	16,8	13,3	18	14,5	19,7	16,3	22,7	19,2	25,6	22,1										10,1	6,7	1,73								
SC 3/4			9,8	5,8	12,8	8,7	15,7	11,6	16,9	12,8	18,6	14,6	21,5	17,5	24,5	20,4	27,4	23,4										11,8	7,8	1,75						
SC 4					11,6	7	14,6	10,0	15,7	11,1	17,5	12,9	20,4	15,8	23,4	18,7	26,3	21,7	32,2	27,5										13,5	8,9	1,77				
SC 4/5							13,5	8,3	15	9,4	16,4	11,2	19,3	14,1	22,3	17,1	25,2	20	31,1	25,9	36,9	31,7									15,2	10	1,79			
SC 5											15,3	9,5	18,2	12,4	21,1	15,4	24,1	18,3	29,9	24,2	35,8	30										16,9	11,1	1,81		
SC 5/6													17,1	10,8	20	13,7	23	16,6	28,8	22,5	34,7	28,3											18,6	12,2	1,83	
SC 6															18,9	12	21,9	14,9	27,7	20,8	33,6	26,7												20,2	13,3	1,85

Pressure max.	Rotation (STD) (C)	Screw stroke adjustment	Chamber \varnothing (mm)	Air volume (L)		Moving time (sec.) (A)	
				OPEN	CLOSE	OPEN	CLOSE
8 bar	0° - 90°	for 1° 1/6 rotation	63	0,16	0,26	D 0,25 S 0,30	D 0,30 S 0,35

Operating temperature (°C) (B)		
ST (Standard)	HT (High temperature)	LLT (Extreme low temperature)
- 40 to + 80	- 15 to + 150	- 55 to + 80

(A) the above indicated moving time of the actuator is obtained under the following test conditions: (1) room temperature, (2) actuator stroke 90°, (3) solenoid valve with $\varnothing 4$ mm and flow capacity Q_n 400 L/min., (4) inside pipe $\varnothing 8$ mm, (5) medium clean air, (6) air supply pressure 5,5 bar (79,75 Psi), (7) actuator without external resistance load. **Caution:** It has to be expected, e.g. for field applications, when one or more of the above parameters are different, the moving time will be different.

(B) Every temperature range option requires proper components and lubricant. Please contact Air Torque GmbH.

Operating Medium:

The operating medium must be free of dust and oil. The maximum particle size must not exceed 30 μ . (ISO 8573 Part1, Class5). In order to prevent water condensation and/or solidification (ice when actuator works below 0°C), the operating medium must have a dew point equal to -20°C or at least 10°C below the ambient temperature (ISO 8573 Part1, Class3)